

# Tech Tip #100 Axle Eye Bore Diameter Inspection

4641 Industrial Dr. Millington, MI 48746-9300 Tel: (888) 854-6474

#### DO NOT INSTALL A NEW STEMCO Kaiser KINGPIN KIT WITHOUT FOLLOWING THE INSTRUCTIONS IN THIS TECH TIP. IMPROPER INSPECTION OR INSTALLATION MAY JEOPARDIZE THE KINGPIN KIT LIFE AND WARRANTY.

### **APPLICATION**

This Tech Tip applies to the following products:

Dana<sup>®</sup> Spicer<sup>®</sup> Eaton<sup>®</sup> Steer **AXLES**: (single locking draw key design) E-1000I (10,000#) E-1200I (12,000#), E-1201I (12,000#) E-1320I (13,200#)

# STEMCO Kaiser KINGPIN KITS: Kingpin QWIKkit™ (K122E) Kingpin PLUSkit™ (70.122.05, 70.122.95) Kingpin ECONOkit™ (50.122.05)

# **STEP 1. INSPECT FOR WEAR**

Inspect the front axle/steering knuckle assembly for vertical play and end play (wear) per the OEM's suggested method. If a worn condition exists, proceed to Step 2. Teardown Assembly.

### STEP 2. TEARDOWN ASSEMBLY

Use the established OEM procedures to teardown the axle/steering knuckle, kingpin, bushings, thrust bearing and shims. Be sure to fully remove the steering knuckle away from the front axle – exposing the axle eye bore.

### STEP 3. INSPECT AXLE EYE BORE DIAMETER

Clean (wipe down) the axle eye bore. Inspect the top and bottom side of the axle eye bore using the **GO/NO-GO** tool included in the kingpin kit as follows: (refer to Figure A for illustration)

- 1. Hold the **GO/NO-GO** tool "in-line" with the <u>top</u> opening of the axle eye bore. Attempt to insert the tool into the bore. Repeat top opening inspection with the tool rotated to various positions.
- Hold the GO/NO-GO tool "in-line" with the <u>bottom</u> opening of the axle eye bore. Attempt to insert the tool into the bore. Repeat bottom opening inspection with the tool rotated to various positions.



# **STEP 4. INSPECTION RESULTS**

If the GO/NO-GO tool <u>did</u> fit into the axle eye bore to any depth, in any position, If the GO/NO-GO tool did <u>NOT</u> fit into the axle eye bore tool to any depth, in any position,



# THE AXLE EYE BORE DIAMETER IS <u>ACCEPTABLE</u>.



<u>WARNING:</u> Installing a new kingpin kit in an excessively worn axle may cause the kingpin kit to wear prematurely, reduced service life and a voided warranty.

01 577 0035